


MODEL

AKHL1050E

BULLETIN NO. AKHL1050E – 01
DATE OF CHANGE March 2008 Production
DATE April 18, 2008

Subject : Improvement of Fan Pulley


AK13705 **FAN PULLEY** has been improved durability by changing to new aluminum material instead of plastic material. Make sure to fix it by a new **HEX. SCREW 5 X 8** with **Three Bond 1344** or **Loctite 242** after removing oil.

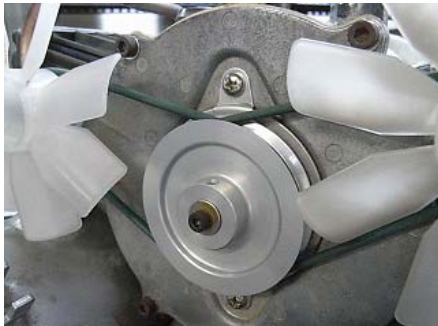

NEW



OLD

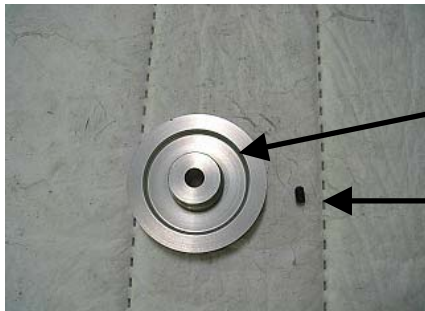

AK13238 FAN PULLEY

AA75415 HEX. SCREW 5 X 8

If AA75415 would be too tight to be removed, it is suggested for you that the screw area should be warmed up by dryer to soften loctite.

ITEM NO.	OLD TYPE		OLD PARTS SUPPLY	NEW TYPE		Interchangeability
	PART NO.	DISCRIPTION		PART NO.	DISCRIPTION	
48	AK13705	FAN PULLEY	N/A	AK13238	FAN PULLEY	Interchangeable
	-	-	-	AA75415	HEX. SCREW 5 X 8	-

Related parts such as No. 99 BB40409 HEX. BOLT 4 X 10, No.112 EE39116 SPECIAL FLAT WASHER 116 and No. 109 EE11103 SPRING WASHER 2-4 are still unchanged.